
# Weathertightness testing an Argeton Rainscreen system of terracotta

Report No. N950/07/13946

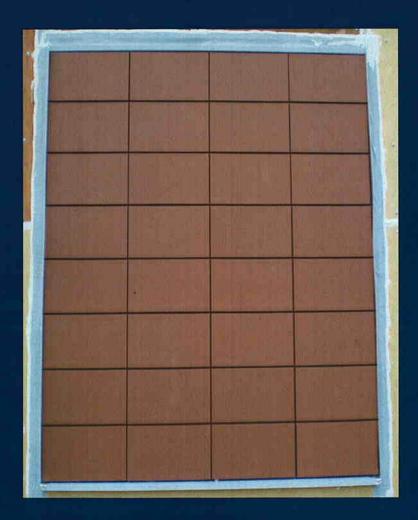

#### Taylor Woodrow Technology Technology Centre

Technology Centre Stanbridge Road Leighton Buzzard Bedfordshire LU7 4QH

Tel: +44 (0)1525 859000 Fax: +44 (0)1525 859001

technologycentre@uk.taylorwoodrow.com www.taylorwoodrow.com/technologycentre



# **Technical Report**

Title

Weathertightness testing an Argeton Rainscreen system of terracotta

Report Number & Date of Issue

N950/07/13946 16 OCTOBER, 2007

Author: D. Bennett Position: Technician TW Job No. 3HE8/C1994

Author's signature:

Checked by: N. McDonald Majurd Position: Principal Engineer

Authorised by: S. R. Moxon S. L. Moxon Position: Manager

Distribution

- 1 copy to TW central area for archive

(confidential)

- 1 copy to TW project file

- 6 copies to Telling

#### **Abstract**

This report is copyright. Reproduction of the whole or any part thereof must not be made without the express permission of Taylor Woodrow. This report and the results shown and any recommendations or advice made herein are based upon the information, drawings, samples and tests referred to in the report. Where this report relates to a test for which Taylor Woodrow is UKAS accredited, opinions and interpretations expressed herein are outside the scope of UKAS accreditation. Taylor Woodrow accepts no liability for any damages, charges, costs (including, but not limited to, legal costs) or expenses in respect of or in relation to any damage to any property or other loss (save for death or personal injury occasioned by reason of any negligence on the part of Taylor Woodrow) whatsoever arising either directly or indirectly from the use of the report, the carrying out of any recommendations contained herein, the following of advice or the use of any goods or materials referred to in this report.

Taylor Woodrow Technology, Technology Centre, Stanbridge Road, Leighton Buzzard, Bedfordshire LU7 4QH

Tel: +44 (0)1525 859111 Fax: +44 (0)1525 859112

technologycentre@uk.taylorwoodrow.com www.taylorwoodrow.com/technologycentre





#### **CONTENTS**

1.	INTRODUCTION	3
2.	DESCRIPTION OF TEST SAMPLE	4
3.	TEST RIG GENERAL ARRANGEMENT	6
4.	TEST SEQUENCE	7
5.	SUMMARY AND CLASSIFICATION OF TEST RESULTS	8
6.	WIND RESISTANCE TESTING	9
7.	WATERTIGHTNESS TESTING	15
8.	IMPACT TESTING	16
9.	SEISMIC MOVEMENT	20
10	APPENDIX - DRAWINGS	21



#### 1. INTRODUCTION

This report describes tests carried out at the Taylor Woodrow Technology Centre at the request of Telling Architectural Limited, Primrose Avenue, Fordhouses, Wolverhampton, West Midlands, WV10 8AW.

The test sample consisted of an Argeton Rainscreen system of terracotta manufactured by Telling.

Taylor Woodrow is accredited by the United Kingdom Accreditation Service as UKAS Testing Laboratory No.0057 and is also approved with Lloyds Register of Quality Assurance for adhoc in-service inspections and tests to ISO 9001 2000.

The tests were carried out on the 11<sup>th</sup> and 12<sup>th</sup> September 2007 and were to determine the weathertightness of the test sample. The test methods were in accordance with the CWCT Standard Test Methods for building envelopes, 2005, for:

Watertightness - dynamic pressure

Wind resistance – serviceability & safety.

The sample was also subjected to the following non UKAS accredited tests in accordance with the Taylor Woodrow Quality System:

Impact resistance. (BS 8200)

Seismic movement. (AAMA 504.4-00)

This test report relates only to the actual sample as tested and described herein.

The results are valid only for the conditions under which the tests were conducted.



#### 2. DESCRIPTION OF TEST SAMPLE

#### 2.1 GENERAL ARRANGEMENT

The sample was as shown in the photo below and the drawings included as an appendix to this report.

The tiles measured 600 mm wide by 300 mm high and were supported by vertical rails at 600 mm centres.

The aluminium rainscreen carrier frame was secured to the backing wall framework with 2 coarse thread self drilling Tek screws at each fixing position.

**PHOTO 00013** 







#### 2.2 CONTROLLED DISMANTLING

During the dismantling of the sample no discrepancies from the drawings were found.

**PHOTO 20027** 





**PHOTO 20028** 

TILE SUPPORT CLIPS






#### 3. TEST RIG GENERAL ARRANGEMENT

The test sample was mounted on a rigid test rig with support steelwork designed to simulate the on-site/project conditions. The test rig comprised a well sealed chamber, fabricated from steel and plywood. A door was provided to allow access to the chamber. Representatives of Telling installed the sample on the test rig. See Figure 1.

FIGURE 1

#### TYPICAL TEST RIG GENERAL ARRANGEMENT

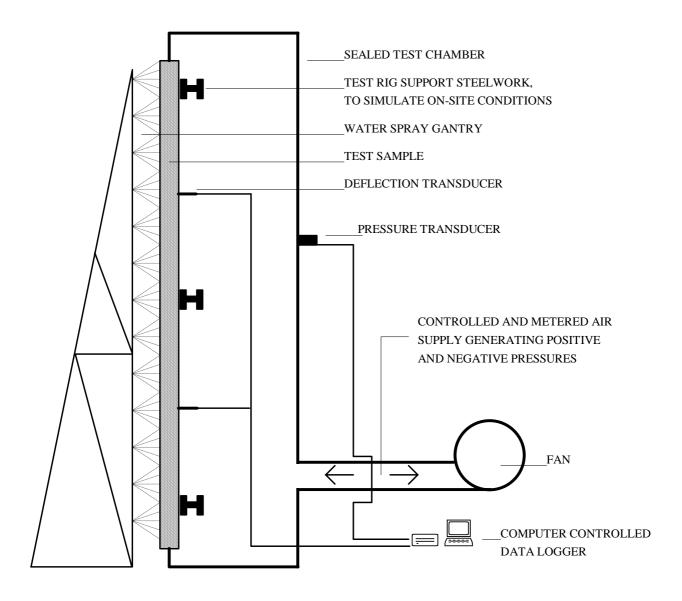

SECTION THROUGH TEST RIG



#### 4. TEST SEQUENCE

The test sequence was as follows:

- (1) Wind resistance serviceability
- (2) Wind resistance safety
- (3) Watertightness dynamic
- (4) Impact resistance
- (5) Seismic movement



#### 5. SUMMARY AND CLASSIFICATION OF TEST RESULTS

The following summarises the results of the tests carried out. For full details refer to Sections 6, 7, 8 and 9.

TABLE 1

Date	Test number	Test description	Result
11 September 2007	1	Wind resistance – serviceability	Pass
11 September 2007	2	Wind resistance – safety	Pass
12 September 2007	3	Watertightness – dynamic	Pass
12 September 2007	4	Impact resistance	Pass
12 September 2007	5	Seismic movement	Pass

#### TABLE 2

Test	Standard	Classification / Declared value
Wind resistance	CWCT	2400 pascals



#### 6. WIND RESISTANCE TESTING

#### **6.1 INSTRUMENTATION**

#### 6.1.1 Pressure

One static pressure tapping was provided to measure the chamber pressure and was located so that the readings were unaffected by the velocity of the air supply into or out of the chamber

A pressure transducer, capable of measuring rapid changes in pressure to within 2% was used to measure the differential pressure across the sample.

#### 6.1.2 Deflection

Displacement transducers were used to measure the deflection of principle framing members to an accuracy of 0.1 mm. The gauges were set normal to the sample framework at midspan and as near to the supports of the members as possible and installed in such a way that the measurements were not influenced by the application of pressure or other loading to the sample. The gauges were located at the positions shown in Figure 2.

#### 6.1.3 Temperature

Platinum resistance thermometers (PRT) were used to measure air temperatures to within 1°C.

#### 6.1.4 General

Holes were introduced in the backing wall and insulation to enable the pressure to reach the tiles. During these tests the joints between the tiles were taped over.

Electronic instrument measurements were scanned by a computer controlled data logger, which also processed and stored the results.

All measuring instruments and relevant test equipment were calibrated and traceable to national standards.

#### 6.2 FAN

The air supply system comprised a variable speed centrifugal fan and associated ducting and control valves to create positive and negative static pressure differentials. The fan provided essentially constant air flow at the fixed pressure for the period required by the tests and was capable of pressurising at a rate of approximately 600 pascals in one second.

#### **6.3 PROCEDURE**

#### 6.3.1 Wind Resistance – serviceability

Three positive pressure differential pulses of 1200 pascals were applied to prepare the sample. The displacement transducers were then zeroed.

The sample was subjected to one positive pressure differential pulse from 0 to 2400 pascals to 0. The pressure was increased in four equal increments each maintained for 15 ±5 seconds. Displacement readings were taken at each increment. Residual deformations were measured on the pressure returning to zero.



Any damage or functional defects were recorded.

The test was then repeated using a negative pressure of -1200 pascals.

#### 6.3.2 Wind Resistance – safety

Three positive pressure differential pulses of 1200 pascals were applied to prepare the sample. The displacement transducers were then zeroed.

The sample was subjected to one positive pressure differential pulse from 0 to 3600 pascals to 0. The pressure was increased as rapidly as possible but not in less than 1 second and maintained for 15 ±5 seconds. Displacement readings were taken at peak pressure. Residual deformations were measured on the pressure returning to zero.

Any damage or functional defects were recorded.

The test was then repeated using a negative pressure of –3600 pascals.



#### FIGURE 2

#### **DEFLECTION GAUGE LOCATIONS**

#### **External View**

Ž	3	
	2	
X		
Ď.	<u>v</u> 1	



#### 6.4 PASS/FAIL CRITERIA

#### 6.4.1 Calculation of permissible deflection

Gauge number	Member	Span (L) (mm)	Permissible deflection (mm)	Permissible residual deformation
2	Vertical support rail	2400	L/200 = 12.0	1 mm

#### 6.5 RESULTS

Test 1 (serviceability) Date: 11 September 2007

The deflections measured during the wind resistance test, at the positions shown in Figure 2, are shown in Tables 4 and 5.

#### **Summary Table:**

Gauge number	Member	Pressure differential (Pa)	Measured deflection (mm)	Residual deformation (mm)
2	Vertical	2440	6.4	0.1
	support rail	-2417	-7.1	-0.7

No damage to the test sample was observed.

Ambient temperature = 20°C Chamber temperature = 22°C

Test 2 (safety) Date: 11 September 2007

The deflections measured during the structural safety test, at the positions shown in Figure 2, are shown in Table 6.

No damage to the sample was observed.

Ambient temperature = 20°C Chamber temperature = 22°C



TABLE 4

#### WIND RESISTANCE - POSITIVE SERVICEABILITY TEST RESULTS

Position	Pressure (pascals) / Deflection (mm)								
	609	609 1181 1780 2440 Residual							
1	0.8	1.5	2.2	2.8	0.1				
2	3.7	6.3	8.6	10.6	0.2				
3	3.0	4.0	4.8	5.5	0.1				
2 *	1.8	3.5	5.1	6.4	0.1				

<sup>\*</sup> Mid-span reading adjusted between end support readings

TABLE 5

#### WIND RESISTANCE - NEGATIVE SERVICEABILITY TEST RESULTS

Position	Pressure (pascals) / Deflection (mm)						
	-621 -1228 -1855 -2417 Residual						
1	-0.9	-2.0	-3.6	-5.3	-0.4		
2	-2.8	-5.7	-8.8	-11.8	-0.9		
3	-1.0	-2.0	-3.0	-4.1	-0.2		
2 *	-1.9	-3.7	-5.5	-7.1	-0.7		

<sup>\*</sup> Mid-span reading adjusted between end support readings



TABLE 6

#### WIND RESISTANCE - SAFETY TEST RESULTS

Position	Pressure (pascals) / Deflection (mm)					
	3588 Residual -3582 Residua					
1	4.3	0.4	-8.1	-0.6		
2	14.6	0.5	-16.6	-1.1		
3	6.6	0.2	-6.2	-0.8		
2 *	9.1	0.2	-9.5	-0.4		

<sup>\*</sup> Mid-span reading adjusted between end support readings



#### 7. WATERTIGHTNESS TESTING

#### 7.1 INSTRUMENTATION

#### 7.1.1 Water Flow

An in-line water flow meter was used to measure water supplied to the spray gantry to within 5%.

#### 7.1.2 Temperature

Platinum resistance thermometers (PRT) were used to measure air and water temperatures to within 1°C.

#### **7.2 FAN**

A wind generator was mounted adjacent to the external face of the sample and used to create positive pressure differentials during dynamic testing. The wind generator comprised a piston type aero-engine fitted with 4 m diameter contra-rotating propellers.

#### 7.3 WATER SPRAY

The water spray system comprised nozzles spaced on a uniform grid not more than 700 mm apart and mounted approximately 400 mm from the face of the sample. The nozzles provided a full-cone pattern with a spray angle between 90° and 120°. The spray system delivered water uniformly against the exterior surface of the sample.

#### 7.4 PROCEDURE

Water was sprayed onto the sample using the method described above at a flow rate of at least 3.4 litres/m²/minute.

The aero-engine was used to subject the sample to wind of sufficient velocity to produce a pressure differential of 600 pascals. These conditions were maintained for 15 minutes. Throughout the test the inside of the sample was examined for water penetration.

#### 7.5 PASS/FAIL CRITERIA

There shall be no water penetration to the internal face of the sample throughout testing.

#### 7.6 RESULTS

Test 3 Date: 12 September 2007

No water penetration was observed throughout the test.

Chamber temperature = 12°C Ambient temperature = 9°C

Water temperature =  $14^{\circ}$ C



#### 8. IMPACT TESTING

#### 8.1 IMPACTOR

#### 8.1.1 Soft body

The soft body impactor comprised a canvas spherical/conical bag 400 mm in diameter filled with 3 mm diameter glass spheres with a total mass of approximately 50 kg suspended from a cord at least 3 m long.

#### 8.1.2 Hard body

The hard body impactor was a solid steel ball of 50 mm or 62.5 mm diameter and approximate mass of 0.5 kg or 1.0 kg.

#### 8.2 PROCEDURE (BS 8200)

#### 8.2.1 Soft body

The impactor almost touched the face of the sample when at rest. It was swung in a pendular movement to hit the sample normal to its face. The test was performed at the locations shown in Figure 3. The impact energies were 120, 350 and 500 Nm.

#### 8.2.2 Hard body

The impactor almost touched the face of the sample when at rest. It was swung in a pendular movement to hit the sample normal to its face. The test was performed at the locations shown in Figure 3. The impact energies were 3, 6 and 10 Nm.

#### 8.3 PASS/FAIL CRITERIA

#### 8.3.1 At impact energies for retention of performance

There shall be no failure, significant damage to surface finish or significant indentation.

#### 8.3.2 At impact energies for safety

The structural safety of the building shall not be put at risk, no parts shall be made liable to fall or to cause serious injury to people inside or outside the building. The soft body impactor shall not pass through the wall. Damage to the finish and permanent deformation on the far side of the wall may occur.



#### 8.4 RESULTS

<u>Test 4</u> Date: 12 September 2007

#### Location 1.

120 Nm soft body. No damage to the sample was observed.

#### Location 2.

120 and 350 Nm soft body. No damage to the sample was observed.

500 Nm. The impact cracked the top of the tiles below. The tiles remained secure. See photo 20018.

#### Location 3.

120, 350 and 500 Nm soft body. No damage to the sample was observed.

#### Location 4.

500 Nm soft body. No damage to the sample was observed.

#### Location 5.

500 Nm soft body. No damage to the sample was observed.

6 Nm hard body. No damage to the sample was observed.

#### Location 6.

3 Nm hard body. No damage to the sample was observed.

#### Location 7.

10 Nm hard body. The tile cracked but remained secure. See photo 20025.

Ambient temperature = 13°C



#### FIGURE 3

#### IMPACT TEST LOACTIONS

#### **External View**

X	×		
X	4	3	<b>※</b> 7
€ 5	<b>※1</b>	Č	2
₩6			



#### **PHOTO 20018**

#### **LOCATION 2 IMPACT**



#### PHOTO 20025

#### **LOCATION 7 IMPACT**



Taylor Woodrow

#### 9. SEISMIC MOVEMENT

#### 9.1 PROCEDURE (AAMA 504.4-00)

#### Seismic serviceability.

The top horizontal support beam was moved sideways by 24 mm in each direction three times.

#### Seismic safety

The test was then repeated once in each direction but the movement was increased to 36 mm.

#### 9.2 RESULTS

Test 5 Date: 12 September 2007

No damage to the sample was observed.

Ambient temperature = 15°C





#### 10. APPENDIX - DRAWINGS


The following 14 unnumbered pages are copies of Telling Architectural Aluminium drawings numbered:
L001,
L002,
L003,
L004,
M001,
M002,
M003,
M004,
M005,
M006,
M007,
M008,
M009 rev A,
M010.


END OF REPORT



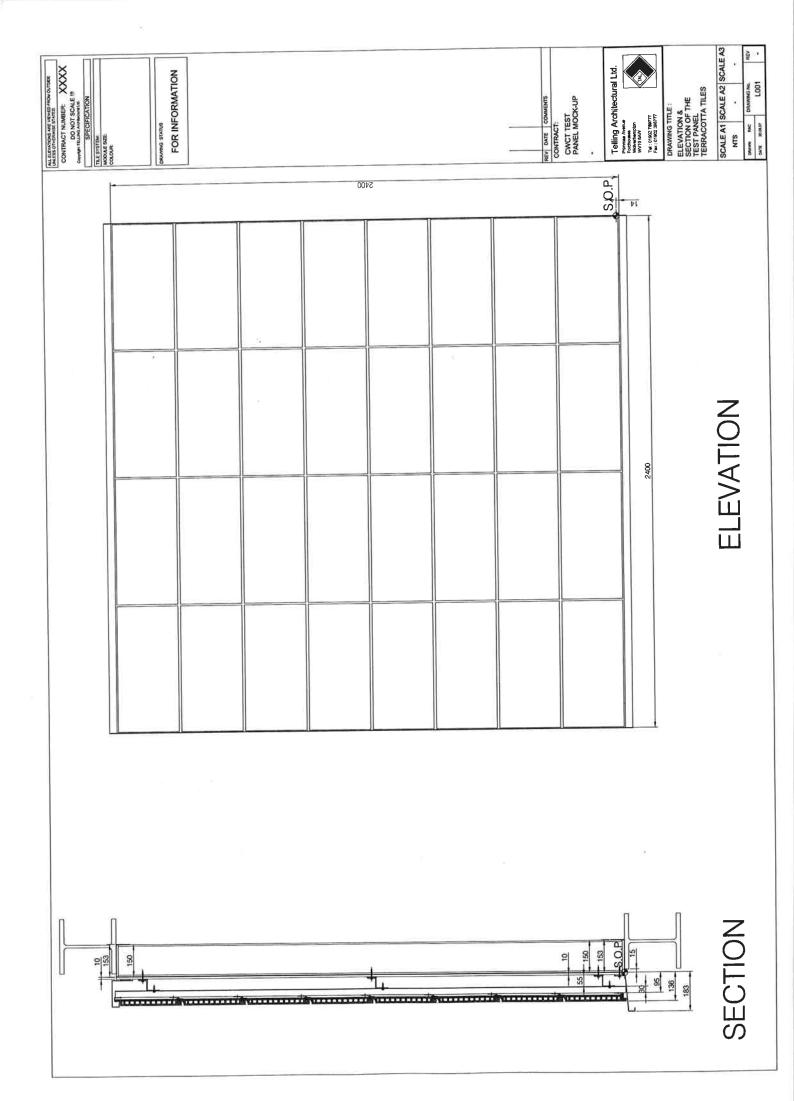

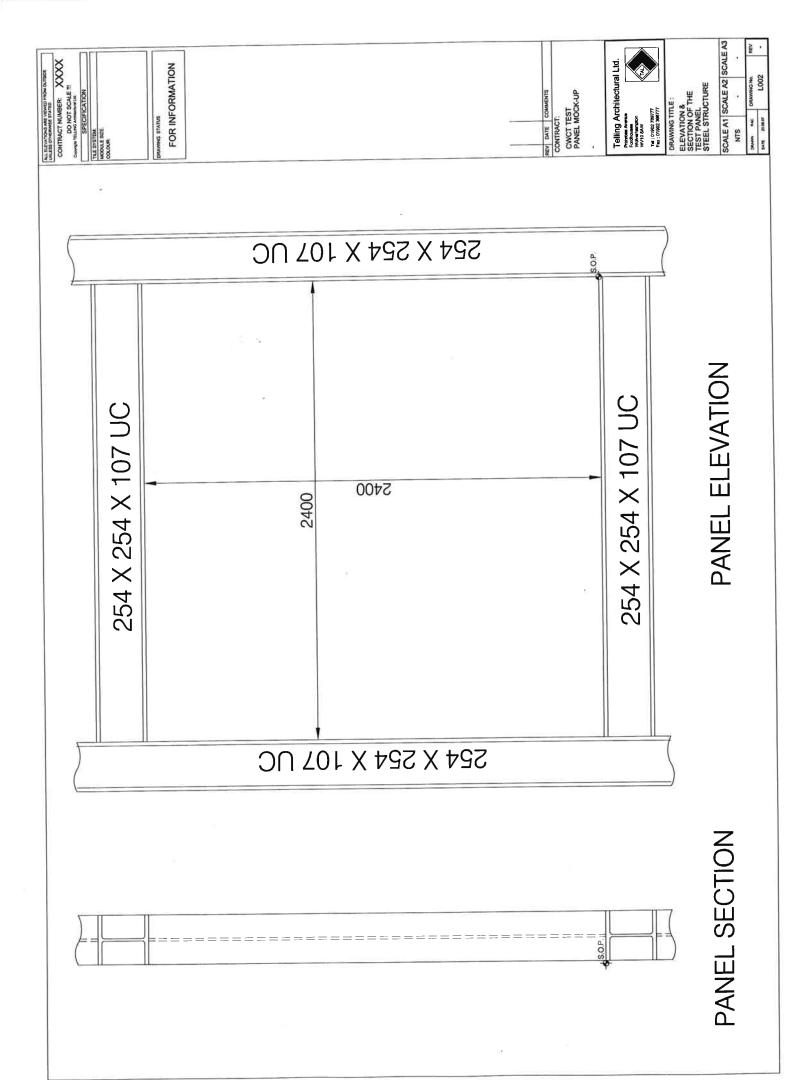

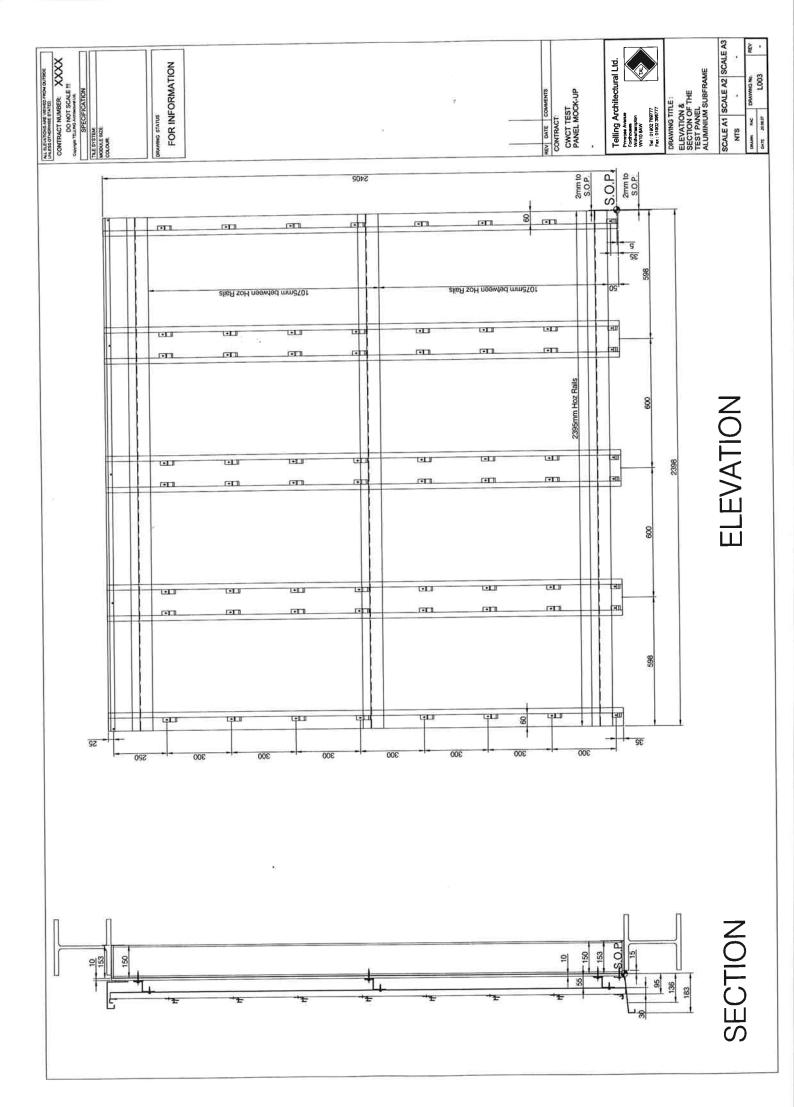

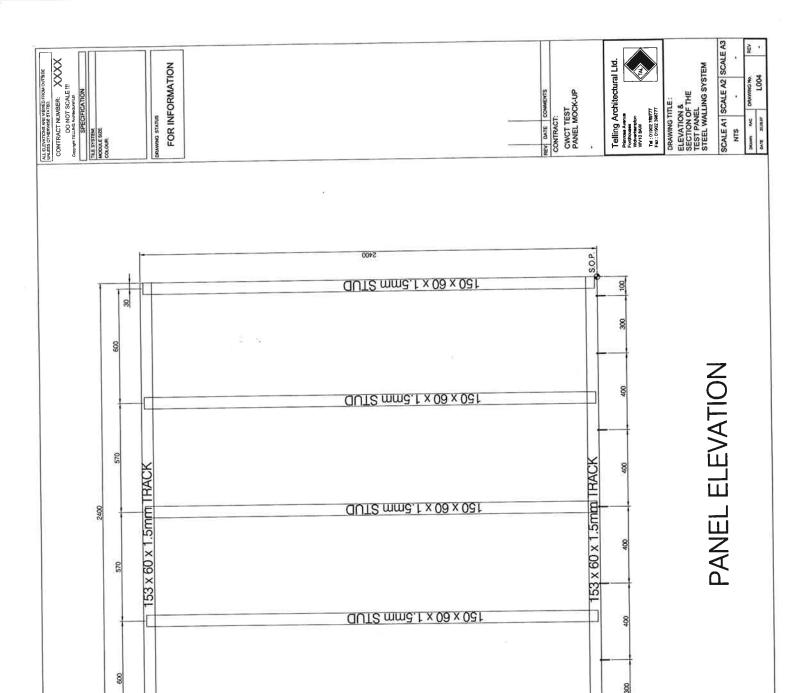



**QUTS mm**3.1 x 03 x 031

**QUTS** mm3.1 x 00 x 031

# PANEL SECTION

8

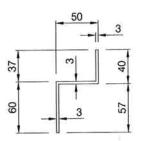

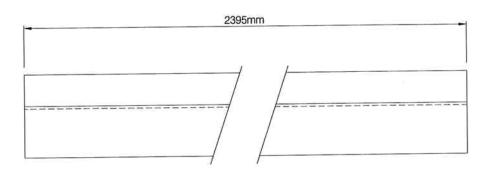


# elevation

#### Telling Architectural Ltd.



MATERIAL 6063 T6		CONTRACT	CWCT TEST PANEL		2
GAUGE / GRADE	3mm				
SIZE / LENGTH	AS DRAWN	DESCRIPTION	HORIZONT	AL RAILS	3
FINISH	N/A	LOCATION	TEST PANI	EL	
COLOUR	MILL	SCALE	NTS		
QUANTITY	3 No.	DATE	20-08-07		
JOINT STRAPS	N/A	DRAWING	M001	REV	•
	GAUGE / GRADE SIZE / LENGTH FINISH COLOUR QUANTITY	GAUGE / GRADE 3mm  SIZE / LENGTH AS DRAWN  FINISH N/A  COLOUR MILL  QUANTITY 3 No.	GAUGE / GRADE 3mm  SIZE / LENGTH AS DRAWN DESCRIPTION  FINISH N/A LOCATION  COLOUR MILL SCALE  QUANTITY 3 No. DATE	GAUGE / GRADE 3mm  SIZE / LENGTH AS DRAWN DESCRIPTION HORIZONT FINISH N/A LOCATION TEST PANI COLOUR MILL SCALE NTS  QUANTITY 3 No. DATE 20-08-07	GAUGE / GRADE 3mm  SIZE / LENGTH AS DRAWN DESCRIPTION HORIZONTAL RAILS FINISH N/A LOCATION TEST PANEL  COLOUR MILL SCALE NTS  QUANTITY 3 No. DATE 20-08-07

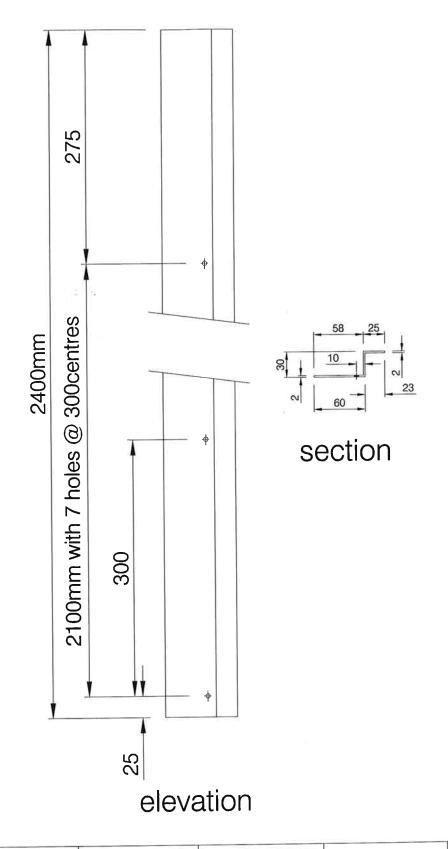



Telling Architectural Ltd.
Primrose Avenue
Fordhouses
Wolverhampton
WV10 8AW





	MATERIAL	6063 T6	CONTRACT	CWCT TEST PANE TAYWOOD		81
٦	GAUGE / GRADE	2mm				
	SIZE / LENGTH	AS DRAWN	DESCRIPTION	LEFT VERT. Z SECTION		
	FINISH	N/A	LOCATION	TEST PANEL		
	COLOUR	MILL	SCALE	NTS		
	QUANTITY	1 No.	DATE	20-08-07		
	JOINT STRAPS	N/A	DRAWING	M002	REV	•

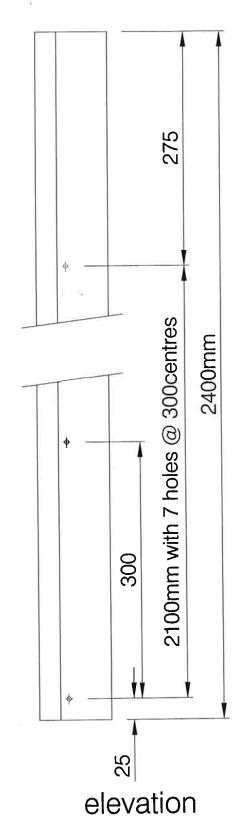

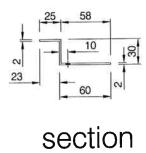


## Telling Architectural Ltd.





	MATERIAL	6063 T6	CONTRACT	CWCT TEST PANEL TAYWOOD		
	GAUGE / GRADE	2mm				
	SIZE / LENGTH	AS DRAWN	DESCRIPTION	RIGHT VERT. Z SECT.		т.
	FINISH	N/A	LOCATION	TEST PANEL		
	COLOUR	MILL	SCALE	NTS		
	QUANTITY	1 No.	DATE	20-08-07		
	JOINT STRAPS	N/A	DRAWING	M003	REV	Ħ

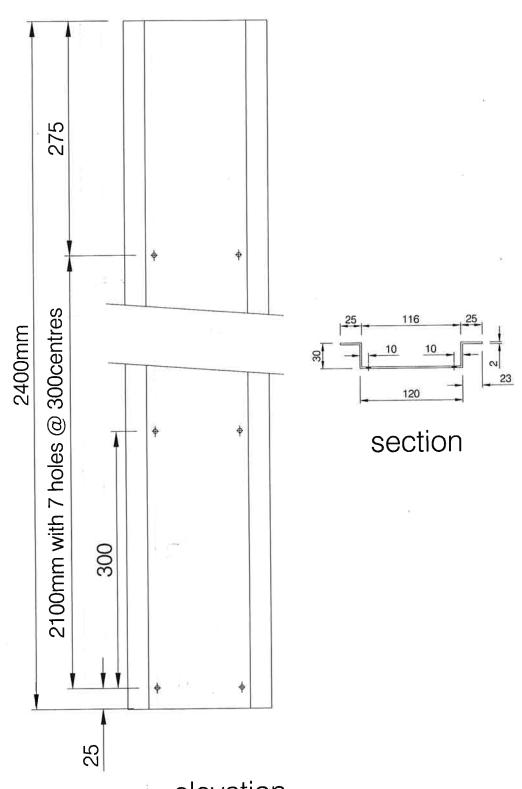


# elevation

#### Telling Architectural Ltd.





	MATERIAL	6063 T6	CONTRACT	CWCT TEST PANEL TAYWOOD		<u> </u>	
1	GAUGE / GRADE	2mm					
	SIZE / LENGTH	AS DRAWN	DESCRIPTION	VERTICAL TOPHAT			
	FINISH	N/A	LOCATION	TEST PANEL			
	COLOUR	MILL	SCALE	NTS			
	QUANTITY	3 No.	DATE	20-08-07			
	JOINT STRAPS	N/A	DRAWING	M004	REV	-	

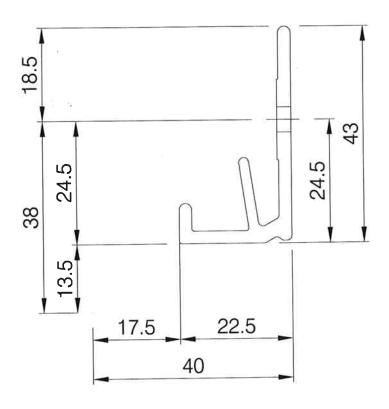


## Telling Architectural Ltd.





	MATERIAL	6063 T6	CONTRACT	CWCT TEST PANE TAYWOOD		ä
	GAUGE / GRADE	2mm				
	SIZE / LENGTH	AS DRAWN	DESCRIPTION	BASE CLIP		
	FINISH	ANODISED	LOCATION	TEST PANEL		
	COLOUR	ANODISED	SCALE	NTS		
	QUANTITY	8 No.	DATE	20-08-07		
	JOINT STRAPS	N/A	DRAWING	M005	REV	•

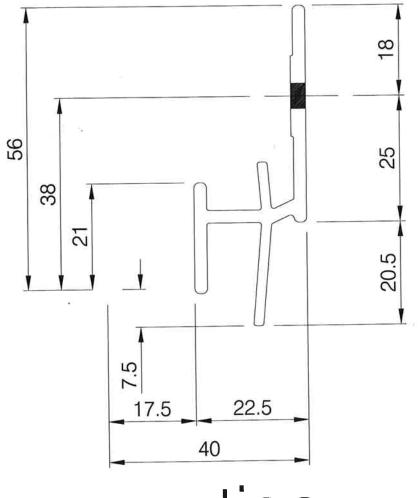


## Telling Architectural Ltd.


Primrose Avenue Fordhouses Wolverhampton WV10 8AW

Tel: 01902 789777 Fax: 01902 398777



	MATERIAL	6063 T6	CONTRACT	CWCT TEST PANEL TAYWOOD		ž
-	GAUGE / GRADE	2mm				
	SIZE / LENGTH	AS DRAWN	DESCRIPTION	INTERMEDIATE CLIP		Ρ
	FINISH	PPC	LOCATION	TEST PANEL		
	COLOUR	RAL 8004	SCALE	NTS		
	QUANTITY	56 No.	DATE	20-08-07		
	JOINT STRAPS	N/A	DRAWING	M006	REV	•

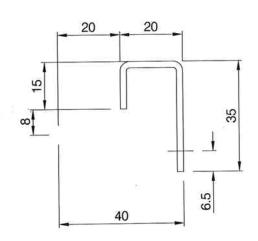

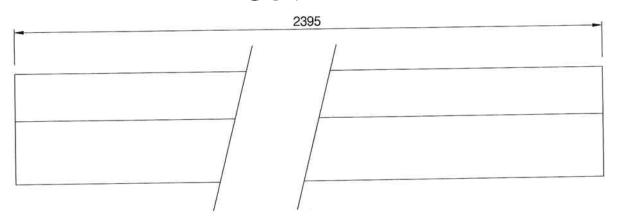


# Elevation

## Telling Architectural Ltd.



	MATERIAL	6063 T6	CONTRACT	TAYWOOD		
1	GAUGE / GRADE	2mm				
	SIZE / LENGTH	AS DRAWN	DESCRIPTION	CONT. TOP	CLIP	
	FINISH	PPC	LOCATION	TEST PANEL		
	COLOUR	RAL 8004	SCALE	NTS		
	QUANTITY	1 No.	DATE	20-08-07		
	JOINT STRAPS	N/A	DRAWING	M007	REV	•

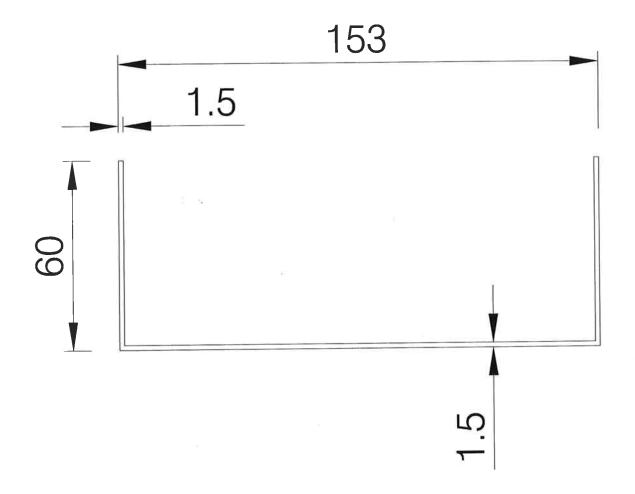



# Steel Track

## Telling Architectural Ltd.




	MATERIAL	Fe350 z275	CONTRACT	CWCT TEST PANE	L	
1	GAUGE / GRADE	1.5mm				
l	SIZE / LENGTH	2380	DESCRIPTION	STEEL TRACK		
	FINISH	N/A	LOCATION	TEST PANEL		
	COLOUR	N/A	SCALE	NTS		
	QUANTITY	2 No.	DATE	20-08-07		
	JOINT STRAPS	N/A	DRAWING	M008 REV	-	

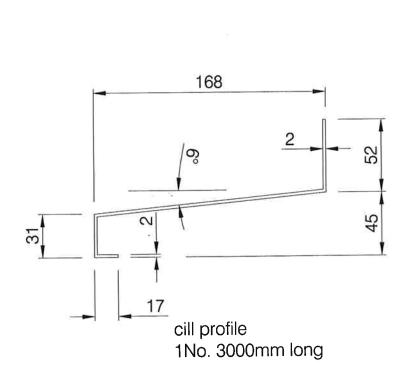


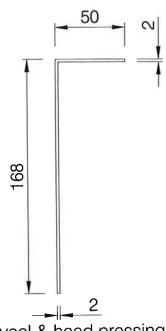

Reveal & head pressings 3No. 3000mm long

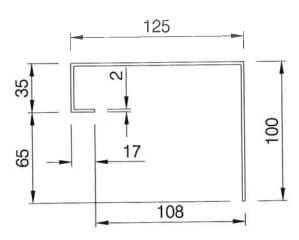



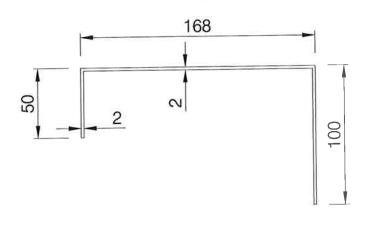

head profile 1No. 3000mm long

FLASHING ADDED


Telling	Archit	ectur	aı L	td.

Primrose Avenue Fordhouses Wolverhampton WV10 8AW



MATERIAL	Aluminium	CONTRACT	CWCT TEST PANEL TAYWOOD		
GAUGE / GRADE	2.0mm				
SIZE / LENGTH	As Drawn	DESCRIPTION	PRESSINGS		
FINISH	N/A	LOCATION	TEST PANEL		
COLOUR	N/A	SCALE	NTS		
QUANTITY	A drawn	DATE	20-08-07		
JOINT STRAPS	N/A	DRAWING	M009	REV	Α

22-08-07

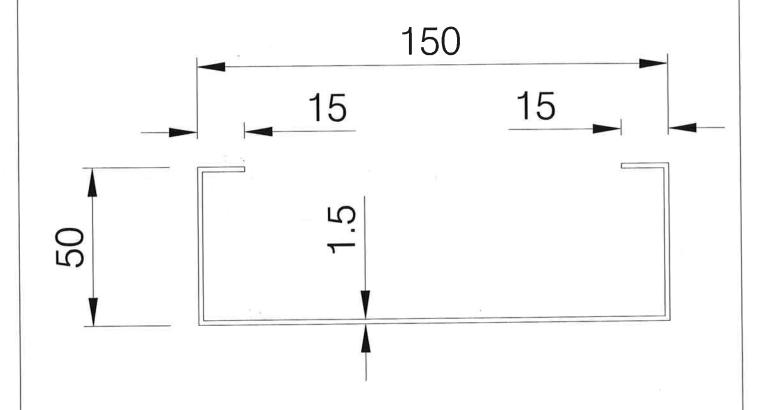

# Steel Stud

### Telling Architectural Ltd.





	MATERIAL	Fe350 z275	CONTRACT	CWCT TEST PAN		
	GAUGE / GRADE	1.5mm				
	SIZE / LENGTH	2370	DESCRIPTION	STEEL STUD		
	FINISH	N/A	LOCATION	TEST PANEL		
	COLOUR	N/A	SCALE	NTS		
	QUANTITY	5 No.	DATE	20-08-07		
	JOINT STRAPS	N/A	DRAWING	M010	REV	8 <b>7</b> 1



#### **Taylor Woodrow Technology**

Technology Centre Stanbridge Road Leighton Buzzard Bedfordshire LU7 4QH

Tel: +44 (0)1525 859000 Fax: +44 (0)1525 859001

technologycentre@uk.taylorwoodrow.com www.taylorwoodrow.com/technologycentre